



VOLKSWAGENWERK AG
Service Department

Workshop Bulletin

No. **57**

Ro 80

of January, 1977

To be marked in Manual Ro 80, 1973 Edition

Pages: 116, 123

with label **57**

Four-point bearing

From Ch. No. 0871 000 334 or Transmission No. 38 348 the four-point bearing (Part No. 672-10-238-01/000) has been replaced by a double taper roller bearing (Part No. 014 311 375 A).

This has also involved modifications to the following parts:

	<u>Old:</u>	<u>New:</u>
Intermediate housing	072-10-01-071/000	072-10-02-071/000
Pinion shaft with crown wheel	672-10-801-02/000	672-10-801-03/000
Spacer tube	072-10-00-089/000	072-10-01-089/000

Assembly and adjustment procedures remain unchanged.


Note:

In the case of vehicles before the Ch. No. or Transmission No. given above, the double taper roller bearing can only be installed together with the modified parts listed.

The four-point bearing and the other old version parts will continue to be available as spare parts.

Old

New

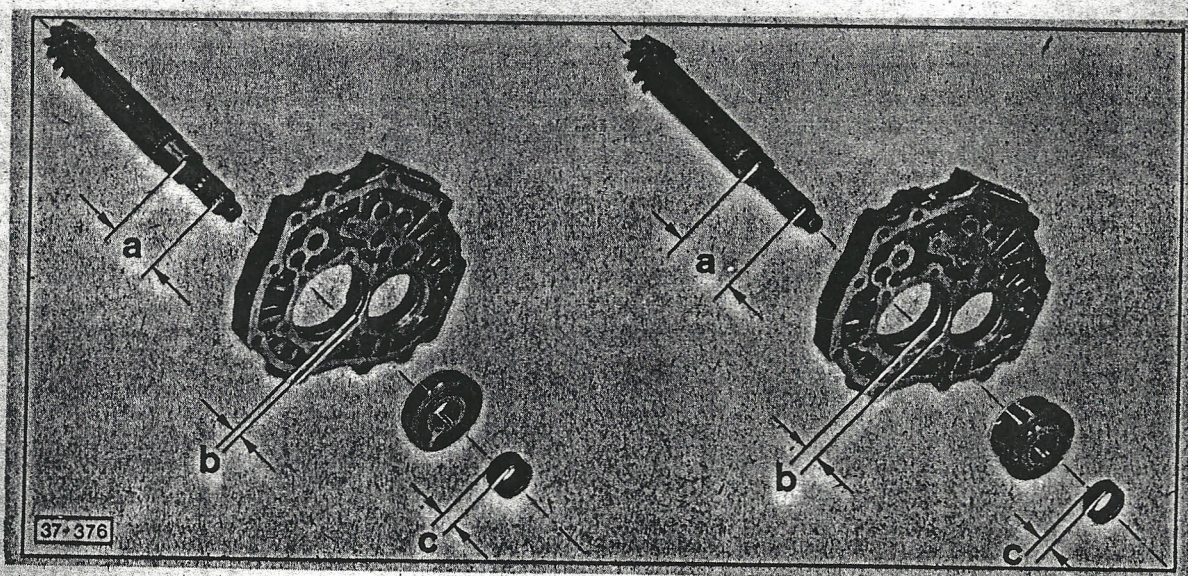

Dimensions:

	<u>Old</u>	<u>New</u>
- a -	53.7 mm	67.5 mm
- b - (depth of recess)	6.6 mm	10.7 mm
- c -	18.5 mm	13.5 mm